



LARK ENGG. CO. (INDIA) PVT. LTD

I.T.I SASOULI ROAD, YAMUNA NAGAR, PH. 91-1732-257685,
259685

SERVICE/ VISIT REPORT

Format: LEC/P-38

Project Name : M/s

Yash Poultry, Kaithal.

Project Location :

Kaithal.

Feed Plant:

Plant

Plant operation:

If Automatic:

Type of Call

Mixer CV Testing.

Name of Service Person (Lark Representative)

Yaman Sharma.

Arrival at Site (Date / Time)

Departure from Site (Date / Time)

Customer Concern

- 1) Mixer - coefficient of variation issue.
- 2) Dust coming from Blowers

Action Taken

- 1) Performed. Mixer CV Testing
Mixer. CV found. Satisfactory
Coefficient of Variation % = 5.273%
which is within in tolerable Range (i.e. $\leq 7\%$)
Report Pdf. has. Shared with Client
(Ranbir Jatten)
- 2) a) Ducting found Choked - cleaned
b) Cyclone & Airlock also found choked
cleaned

Job Completion Status

Completed.

Performance after completion of Job

Satisfied (✓)

General feedback/ comments

905292704

Client Signature with stamp
Representative)

Yaman
16/01/2024
Signature of Service Person (Lark

Note: During Service, you have to arrange lodging facility (free of cost) to our representative during their stay at your site.





Mixer Info

Company*

yash poultry ..

Sampler*

yaman sharma

Mixer Tested*

LHMR-10E


Date Tested*

01/16/2026





Test Results

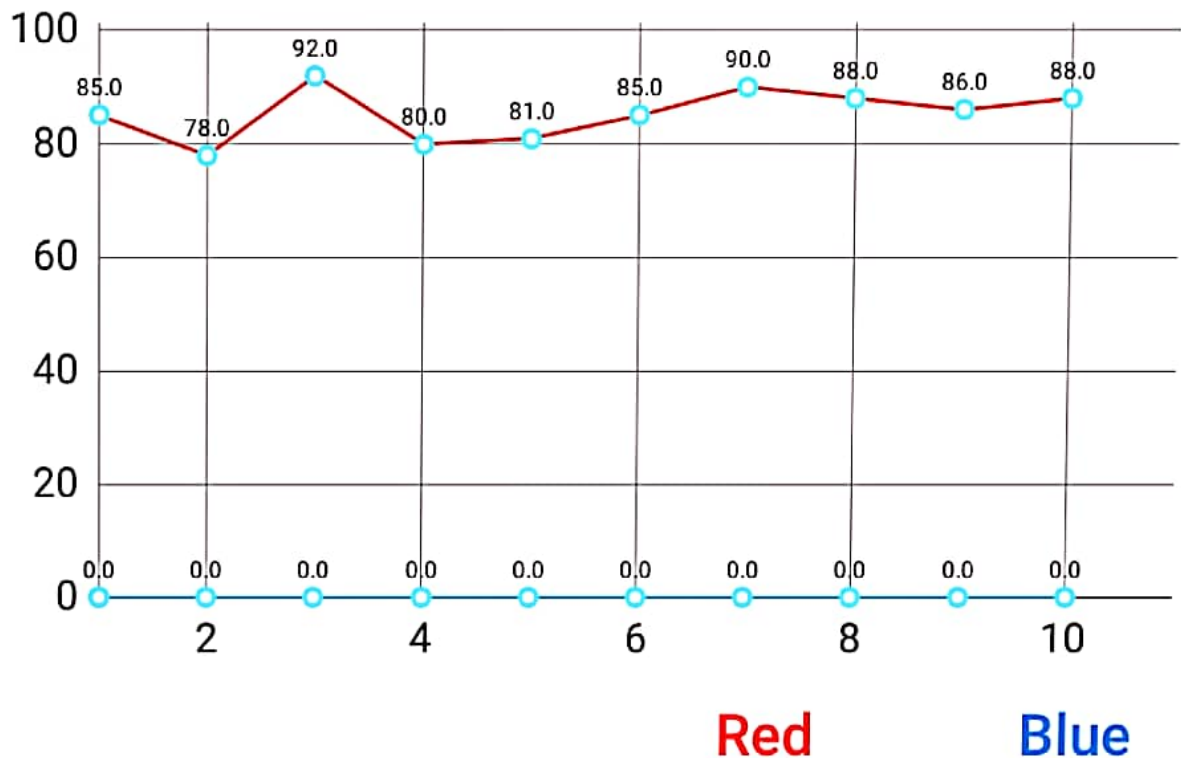

Conclusion (i)	Excellent Mixing	Incomplete Mixing
Chance Probability %	97.66	0.0
Mean	85.30	0.0
Standard Deviation	4.498	0.0
Coefficient of Variation %	5.273	0.0
Recovery %	0.0	0.0



Sample No.

Red

Blue

#1

85

-

#2

78

-

#3

92

-

#4

80

-

#5

81

-

#6

85

-

#7

90

-

#8

88

-

#9

86

-

#10

88

-



